

Vehicle Inspection Report



Conducted by Classic Project Shop, Bicester

Date Completed 20th January 2022

Vehicle Details

Make	Ferrari	Engine no.	TBC
Model	456M GTA	Registration	NA
Chassis no.	ZFFWP50B000121329	Recorded Mileage	36,000KM

Exterior

Area of Inspection	Comments																																				
Bodywork	<ul style="list-style-type: none">Panel fit good and no visible issues with bodywork																																				
Area of Inspection	Comments																																				
Brightwork	<ul style="list-style-type: none">Exterior trim in good condition																																				
Area of Inspection	Comments																																				
Wheels & Tyres	<ul style="list-style-type: none">All in good condition, fitted with Pirelli and to OE specification <table border="1"><thead><tr><th>Position</th><th>Wheel Cond.</th><th>Original Spec.</th><th>Tyre Cond.</th><th>Size</th><th>Year</th></tr></thead><tbody><tr><td>NSF</td><td>Good</td><td>Yes</td><td>Good</td><td>255/45ZR17</td><td>2015</td></tr><tr><td>OSF</td><td>Good</td><td>Yes</td><td>Good</td><td>255/45ZR17</td><td>2015</td></tr><tr><td>NSR</td><td>Good</td><td>Yes</td><td>Good</td><td>285/40ZR17</td><td>2014</td></tr><tr><td>OSR</td><td>Good</td><td>Yes</td><td>Good</td><td>285/40ZR17</td><td>2014</td></tr><tr><td>SPARE</td><td>none fitted</td><td></td><td></td><td></td><td></td></tr></tbody></table>	Position	Wheel Cond.	Original Spec.	Tyre Cond.	Size	Year	NSF	Good	Yes	Good	255/45ZR17	2015	OSF	Good	Yes	Good	255/45ZR17	2015	NSR	Good	Yes	Good	285/40ZR17	2014	OSR	Good	Yes	Good	285/40ZR17	2014	SPARE	none fitted				
Position	Wheel Cond.	Original Spec.	Tyre Cond.	Size	Year																																
NSF	Good	Yes	Good	255/45ZR17	2015																																
OSF	Good	Yes	Good	255/45ZR17	2015																																
NSR	Good	Yes	Good	285/40ZR17	2014																																
OSR	Good	Yes	Good	285/40ZR17	2014																																
SPARE	none fitted																																				
Area of Inspection	Comments																																				
Glass	<ul style="list-style-type: none">In good condition																																				
Area of Inspection	Comments																																				
Lights	<ul style="list-style-type: none">In good working conditionLHD beam pattern																																				

Vehicle Inspection Report

(Continued)



Interior	
Area of Inspection Cosmetic/Trim	Comments <ul style="list-style-type: none">• In good condition• Boot trim would benefit from refitting to stop trim moving and position correctly.
Area of Inspection Function	Comments <ul style="list-style-type: none">• Park light switch occasionally gets stuck and needs gentle persuasion to disengage to turn off lights.

Underside	
Area of Inspection Chassis	Comments <ul style="list-style-type: none">• General condition is all good, clean and straight. Ref Pic 01 and 02
Area of Inspection Front/Rear Suspension	Comments <ul style="list-style-type: none">• Light surface corrosion on suspension arms and aluminium cross bars- Ref pic 03• Rear OS damper shows light oil misting Ref pic 04• Rear OS suspension reservoir shows slight oil mist Ref pic 05• Rear coil overs require the spring seats to be wound quite high to maintain ride height. Ride height is correct, but springs may be updated for stiffness with less travel than standard. Ref pic 04
Area of Inspection Drivetrain	Comments <ul style="list-style-type: none">• In good condition with no obvious play
Area of Inspection	Comments

For
HANGAR136

Vehicle Inspection Report

(Continued)



Exhaust System	<ul style="list-style-type: none">• In good condition with no damage Ref pic 01
Area of Inspection	Comments
Brake System	<ul style="list-style-type: none">• Visually in good condition

Engine Bay

Area of Inspection	Comments
General View	<ul style="list-style-type: none">• Good general condition• Some oil misting around the breathers but not requiring immediate attention- ref pic 06• Oil levels correct and oil in good condition• Slight oil drop from filter canisters seals. Ref pic 07• Cambelt changed in 2021 as part of a comprehensive service.• Coolant levels good and fluid appears in good condition• Brake fluid appears to be dark in colour, would recommend a fluid change.

Test Drive Report

Area of Inspection	Comments
General Notes	<ul style="list-style-type: none">• Car performs well and feels taught• Engine start up is a bit lumpy but improves with running• Tyre canister and fire extinguisher both out of date• Ticking noise from behind the dash, goes away on change of direction eg on roundabout - Reported in service notes in 2019 and 2021 when a replacement aircon unit was fitted.• Drivers side vent occasional light rattle

For



HANGAR136

Vehicle Inspection Report

(Continued)



Photo Evidence

Ref ID	Image
01	Underside general condition 
02	Underside general condition 

For
HANGAR136


Vehicle Inspection Report

(Continued)



03

Suspension light corrosion

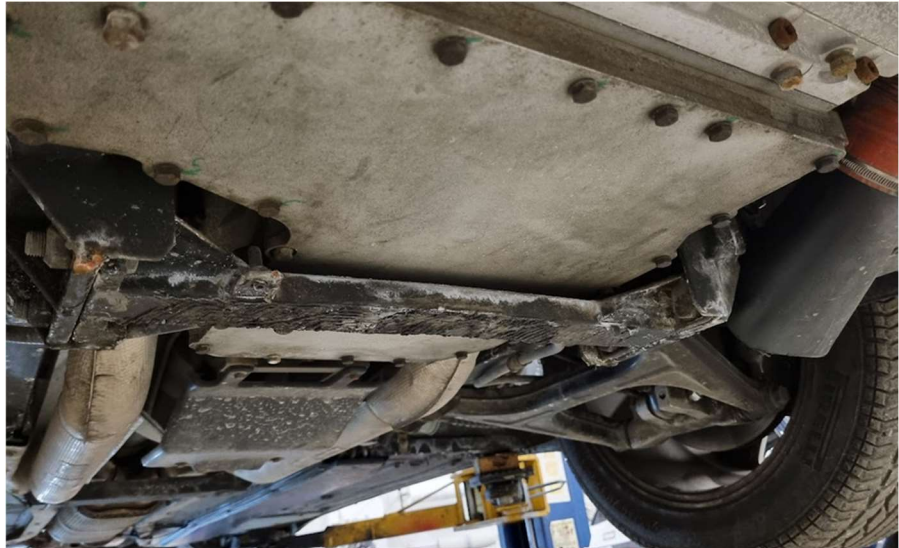

04

OS rear damper light oil misting and high spring seat



For
HANGAR136

Vehicle Inspection Report

(Continued)



05

OS rear ride height revoir oil misting



06

Breather reservoir oil misting



For
HANGAR136

Vehicle Inspection Report

(Continued)



07	Slight oil drop from oil cannisters 