

Plc Save Sunday.
PMD 113124



SPORTING & HISTORIC CAR ENGINEERS

3 Greatworth
Park
Welsh Lane
Banbury
Oxfordshire
OX17 2HB
Tel: 01295 760090

info@timsamways.co.uk
www.timsamways.co.uk

22 February 2024

INVOICE 2783
Ferrari 456 GTA – X934 MES

To:

Put car on ramp, remove undertray, carry out engine service replacing engine oil and filters, air filters, fuel filters and spark plugs.

Replace cambelts and tensioner pulleys.

Replace alternator and water pump belts.

Clean and refit undertray.

Remove rear frame to access auto-box sump, drain and measure oil, remove and clean sump and mating flange. Replace filter and refit sump and frame.

Replenish automatic transmission fluid.

Drain and replenish differential oil.

Run up car, check fluid levels, road test and re-check levels.

Vacuum, clean and polish car.

Load car onto trailer.

Invoice 2783

2		Cambelts	223.18
2		Tensioner Pulleys	371.00
2		Fuel Filters	72.44
2		Air Filters	133.76
2		Oil Filters	127.94
1		Alternator Belt	27.50
1		Water Pump Belt	18.99
12		Spark Plugs	223.32
12	Litres	Engine Oil	120.84
2.5	Litres	Gear Oil	38.15
1		Autobox Filter	88.97
1		Autobox Gasket	65.86
7	Litres	Shell ATF	78.33
		Consumables	<u>5.00</u>
		Parts (as listed)	1,595.28
		Labour (20.5 Hours @ £85/Hour)	<u>1,742.50</u>
			3,337.78
		VAT @ 20%	<u>667.56</u>
		Total:	<u>£4,005.34</u>



Ferrari Specialist



Invoice Number: 20050
Date: 23 December 2021
Make: Ferrari
Model: 456 M GTA
Registration No: X934MES
Chassis No: 120682
Assembly-No:
Mileage: mls
Job Number: 15719

Parts / Materials

Part No.	Description	Qty	Price	Total
65471400	ASH TRAY	2	£170.29	£340.58
Sub-Contract Work Completed				Cost
Carriage for ash trays				£10.75

Parts:	£340.58
Labour:	£0.00
Sub Contract Work:	£10.75
Sundries:	£0.00
Sub Total:	£351.33
VAT @ 20 %:	£70.27
Total Now Due:	£421.60

Bob Houghton Ltd
 Midwinter Road
 Northleach
 Gloucestershire
 GL54 3JD

Tel 01451 860794
 Fax 01451 860424

Directors: R W Houghton, A B Houghton, D R Houghton

@bobhoughtonltd | bobhoughtonltd | @bobhoughtonltd

Registered Office: Midwinter Road, Northleach
 Gloucestershire, GL54 3JD

Registered in Cardiff No. 1609944 | VAT No. 366 1479 32



Ferrari Specialist



Invoice Number: 20001
Date: 25 November 2021
Make: Ferrari
Model: 456 M GTA
Registration No: X934MES
Chassis No: 120682
Assembly-No:
Mileage: 21946 mls
Job Number: 15404

Requirements / Work Completed

Carry out annual service
 Renew cambelts and auxiliary drive belts
 Renew auxiliary belt tensioner bearings
 Renew cambelt tensioners
 Renew battery
 Renew bonnet gas struts
 Remove radiator and send for repair. Had to cut off and remake various undertray fixings and radiator mounts. Refit when done and fill with correct strength anti freeze.
 Fit four new tyres to new wheels, balance wheels and fit to car.
 Repair drivers door check strap
 Recharge air conditioning system
 Take car for MOT

Parts / Materials

Part No.	Description	Qty	Price	Total
206166	OIL FILTER 456/550	2	£21.41	£42.82
0892332001	SCREENWASH PLUS 125ML	1	£1.49	£1.49
C-WASHER	COPPER WASHER	2	£0.55	£1.10
83.13.0.139.897	DOT 4 BRAKE FLUID	1	£11.72	£11.72
64241800	POLLEN FILTER ASSY	1	£82.65	£82.65
187744	CAMBELT	2	£95.40	£190.80
201447	ALT/AC BELT	1	£14.98	£14.98
201456	BELT (PAS PUMP)	1	£23.30	£23.30
65507700	GAS STRUT	2	£24.19	£48.38
65716400	PIN FOR CHECK STRAP	1	£5.55	£5.55
179378	BBS FRONT ALUMINIUM WHEEL	2	£300.00	£600.00
179379	BBS REAR ALUMINIUM WHEEL	2	£300.00	£600.00
082SE	74AH BATTERY (REPLACES E12)	1	£71.30	£71.30
123350	BEARING	2	£24.29	£48.58
171057	TENSIONER BEARING	2	£185.90	£371.80
235000	BOLT IN TYRE VALVE	4	£3.23	£12.92
A-FREEZE	ANTIFREEZE (PER LTR)	6	£7.50	£45.00
5W40	ENGINE OIL	10	£9.75	£97.50

Continued on next page

Bob Houghton Ltd
 Midwinter Road
 Northleach
 Gloucestershire
 GL54 3JD

Tel 01451 860794
 Fax 01451 860424

Directors: R W Houghton, A B Houghton, D R Houghton

[@bobhoughtonltd](#) [bobhoughtonltd](#) [@bobhoughtonltd](#)

Registered Office: Midwinter Road, Northleach
 Gloucestershire, GL54 3JD

Registered in Cardiff No. 1609944 VAT No. 366 1479 32



Sub-Contract Work Completed

Flushed radiator, repaired leak and seam tested
Supply Michelin Pilot Super Sports
2 x 255/40r18 (Fuel D, Wet A, Noise B-71dB)
2 x 295/35r18 (Fuel C, Wet A, Noise B-73dB)
MOT

Cost
£78.00
£876.52

£54.84

Parts: £2,269.89
Labour: £3,487.50
Sub Contract Work: £1,009.36
Sundries: £30.00

Sub Total: £6,796.75
VAT @ 20 %: £1,359.35

Total Now Due: £8,156.10

Bob Houghton Ltd
Midwinter Road
Northleach
Gloucestershire
GL54 3JD


Tel 01451 860794
Fax 01451 860424

www.bobhoughton.co.uk

Directors: R W Houghton, A B Houghton, D R Houghton

Registered Office: Midwinter Road, Northleach
Gloucestershire, GL54 3JD

Registered in Cardiff No. 1609944 **VAT No.** 366 1479 32

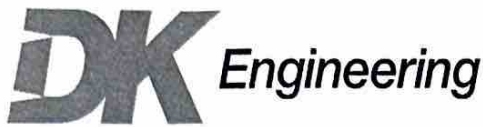

VAT Reg No. 212 4883 22
Company No. 9463316

Tel. +44 (0) 1923 2
Fax. +44 (0) 1923 2
reception@dke.co.
www.dke.co.uk

DK ENGINEERING SERVICING
LITTLE GREEN STREET FARM
GREEN STREET
M66 60593 TID 4879
AID : A000000031010
VISA DEBIT
VISA DEBIT
**** * 0452

Acquisition Consultancy | Sales | Service | Restoration to Perfection | Engine Building | Race Preparation | Rolling Road | Storage

Vehicle:
Reg: X934MES
Make: Ferrari
Model: 456 M GTA
Chassis No: 120628
Engine No:
Mileage In: 0 Out: 0 miles
Fuel (%) In: 0 Out: 0

Copy of Invoice S 12237
Invoice Date: 02/10/2017
Order No:
Customer Ref: SUN001
Status: Account
Advisor: Phil R
Job Sheet No. 3601

Intervention: A
Work Carried Out:

Carry out annual service as per Ferrari service schedule £640.00
Replace broken ball joint £240.00

PARTS/MATERIALS

Description	Unit Price	Qty	Total Nett
Oil filter	£20.99	2	£41.98
Pollen filter	£81.03	1	£81.03
Litre DOT4 brake fluid	£4.50	2	£9.00
Brake cleaner aerosol 500ml	£7.50	1	£7.50
Screenwash additive (250ml)	£2.50	1	£2.50
Litre Shell Helix Ultra 5W/40 engine oil (209)	£10.50	12	£126.00
Ball joint	£162.68	2	£325.36

Intervention Totals: Total Labour: £880.00 Total Parts: £593.37 Intervention Total: £1473.37
Comment

Total VAT Breakdown (All pages)			
Code	Rate	Total (ex VAT)	VAT
T1	20.00%	£1473.37	£294.68

Labour : £880.00
Parts : £593.37
Sub-Total : £1,473.37
VAT : £294.68

Total : £1,768.05

Sort Code: 30-84-86 Acc No: 18820560 IBAN: GB57LOYD30848618820560 BIC:LOYDGB21781

To:-

Invoice No. 7073
Invoice/Tax Date 16/04/2014
Customer Order No.
Account No. CASH01

Thank you for your custom

Qty Ordered	Description	List Price	Net Amount
1.00	Job No. 4979 For Vehicle : PGW456, FERR 456 Repair As Estimate 9233 Labour	480.00	480.00
1.00	Paint and Materials	200.00	200.00

Mr Andrew McCleary
Birch Park
Mount Tabor Road
Perth
PH2 7DE

Total Net Amount £680.00
Total VAT Amount £136.00
Invoice Total £816.00

Invoice Prepared by Michael Roden



12/04/2014

Name

Model

FERRARI-UE
456 M

2001-2003

Plate number/VIN

pgw456

Km

17667

Technician

rw

Work order ID

Notes

Front

Min	Max	Before	After
+0.30°	+0.43°	+0.70°	+0.40°

Total toe

Min	Max	Before	After
+5.30°	+5.70°	--	--
-1.20°	-0.80°	-0.95°	-1.40°
		-1.60°	+0.20°
--	--	--	--
--	--	--	--

Caster

Camber angle

Partial toe

SAI

TOOT

Min	Max	Before	After
+5.30°	+5.70°	--	--
-1.20°	-0.80°	-1.85°	-1.40°
		+2.30°	+0.20°
--	--	--	--
--	--	--	--

Before After

+0.85°	+0.25°
--------	--------

Set-back

Rear

Min	Max	Before	After
+0.37°	+0.50°	+0.35°	+0.40°

Total toe

Min	Max	Before	After
-1.70°	-1.30°	-1.90°	-1.60°
		+0.15°	+0.20°

Camber angle

Partial toe

Min	Max	Before	After
-1.70°	-1.30°	-2.00°	-1.60°
		+0.20°	+0.20°

Before After

+0.20°	+0.15°
-0.00°	-0.00°

Set-back

Thrust angle


S T E W A R T R O D E N
M O T O R S

INVOICE

To: **Date:** 11 April 2014
Invoice No: SRM0742

VEHICLE Ferrari 456 **REG.No.** PGW 456
MILEAGE 17,645

DETAILS: **Belt Service & MOT**

- Remove and replace 12 spark plugs
- Remove and replace engine oil and oil filter
- Check and replace battery
 - Check and clean air filter
 - Check and clean pollen filter
- Check and replace diff oil (very dirty)
 - Check gearbox oil (OK)
 - Replace antifreeze
 - Check air conditioning - required re-charge
 - Check fuel pipes - OK
 - Check electrical connections in engine bay
 - Strip timing covers and air filter boxes.
- Remove and replace timing belts, tensioner bearings and auxilliary belts. Rebuild
- Check 4 corners suspension
- Remove all 4 dampers (leaking) and send to Bilstein for refurbishment. Rebuild to car after overhaul.
- Remove and replace front N/S top balljoint
- Strip front and rear brakes, clean, de-glaze, clean callipers, re-paint brake discs, lubricate. Replace front brake pads (pad material coming away from backing plate)
- Rebuild brakes.
- Bleed brakes
- Replace handbrake shoes (worn)
- Clean and free-off handbrake cable (seized)
- Replace front brake air duct piping (breaking up & splitting)
 - Remove and replace all wheel studs (corroded)
 - Check tyres (OK)
- Repair puncture to O/S/R tyre (nail)
 - Re-set engine ECU
 - Road test. MOT
 - Clean, valet, wax & polish complete car

Labour: £1,575.00

Edinburgh Road, Glendevon, by Winchburgh, West Lothian EH52 6PX
Telephone. 01506 890724 Facsimile. 01506 891724 Email. admin@swroden.co.uk
VAT Registration No. 402 7617 74



Re-set 4-wheel alignment	Alignment:	£50.00
Re-charge air conditioning	Air Con:	£50.00

Suspension

Clean salt and corrosion from all 4 suspension corners.

Re-paint. Touch in and re-paint corroded parts

Apply waxoyl protection to all exposed parts.

Rubberguard various parts around the floor section.

Suspension: £120.00

Engine

On removing the cylinder heads it was apparent that the valve guides would require to be replaced as well as the valve stem seals.

The cylinder heads were completely stripped down removing all auxilliary piping, etc. Cam shafts, valve guides, valves and valve seats were.

all removed

Both heads required to be skimmed as there was evidence of coolant leaking through the aluminium and corrosion had set in.

On checking valve guides supplied by Ferrari, which are similar to the 430 it was decided to have copies of the original valve stem guides made.

We had to specialist re-manufacture engine valve shims, in order to re-set the the valve clearances correctly.

We had to rebuild the complete top end of the engine, replacing cylinder head gaskets and all other gaskets and seals associated with the cylinder head.

Labour: £3,750.00

Parts

- Oil Filter x 2 @ £22.20	£44.40	
- Engine oil	£95.40	
- 2 sump plug washers	£3.96	
- 12 spark plugs @ £12.95	£155.40	
- Battery	£75.00	
- Diff Oil	£32.85	
- Antifreeze	£27.00	
- 2 Brake ducting pipes	£20.00	
Front brake pads	£101.00	
- Handbrake shoes	£105.60	
- Handbrake springs x 2	£17.08	
Brake fluid	£15.00	
Shock Absorber fluid	£12.00	
- Copper washers for shock absorber pipes	£4.40	
- N/S/F top balljoint	£91.20	
V12 valve guides inlet x 24 @ £24	£576.00	
V12 valve guides exhaust x 24 @ £24	£576.00	
OR Gasket	£0.17	
12 gaskets @ £0.85	£10.20	
2 gaskets @ £0.60	£1.20	
4 OR gaskets @ £0.25	£1.00	
2 cover gaskets @ £33.32	£66.64	
1 gasket @ £7.07	£7.07	
7 OR gaskets @ £3.85	£26.95	
4 gaskets @ £7.14	£28.56	
4 gaskets @ £7.98	£31.92	
2 inlet gaskets @ £7.73	£15.46	
- 2 head gaskets @ £171.53	£343.06	152=40

Parts (Cont)	- 12 exhaust manifold gaskets @ £13.30	£159.60	2 = £26.60
	- 48 stem seals @ £4.83	£231.84	
	- 2 timing belts @ £34.20	£68.40	
	- 2 idler bearings @ £94.48	£188.96	
	- 2 auxilliary drive belts @ £19.70	£39.40	
	- 10 front wheel studs @ £15	£150.00	
	- 10 rear wheel studs @ £12.17	£121.70	
	- Waxoyl	£45.00	
	- Nuts, bolts & sundries	£40.00	
	- UPS Delivery costs	£38.00	

Total Parts: £3,567.42

Specialist:	- <u>Bilstein</u> Shock Absorber Overhaul	£180.00
	- Carriage to/from Bilstein	Bilstein: £29.00

Jem Engines: Machine/skim/grind 13 shims
 Remove and fit 24 exhaust guides and 24 inlet guides.
 Clean & reface 48 valves, dress 24 seats, skim cylinder
 heads and ream out 48 gides.

Jem: £1,460.00

	Net Total	£10,781.42
	VAT @ 20%	£2,156.28
	MOT	£54.85
	Total Invoice	£12,992.55

Martin's Aston Services



Fruachan House
4 Beech Road
Lenzie
Glasgow G66 4HN

0141 776 4430

service@martinsastonservices.co.uk

Invoice 160

Ferrari 456M GTA Chassis C000120628
PGW 456 Mileage 16734

To work carried out in February.

Smoke & Exhaust work continued from previous invoice

Refit two rear exhaust boxes with new clamps.

Secure two middle box clamps.

Fit right hand rear box bolt assemblies and rubber mounts.

Repeat with left hand box.

Swap manifold to catalyst bolts for correct spring loaded ones to replace broken items.

Adjust all assemblies and rubbers to ensure system does not vibrate against body, this required considerable loosening and retightening of clamps and fittings.

Refit heat shield to catalyst wiring.

After road tests (see below) check exhaust system for blowing and all seals.

Labour 14.75 hours @ £30 per hour

£442.50

Parts

Exhaust gasket 154363 x 2

£ 26.69

Exhaust screw 16045024 x 2

£ 1.66

Exhaust washer 112761 x 16

£ 13.25

Exhaust spacers 114749 x 6

£ 6.20

Exhaust nut 179808 x 4

£ 2.21

Exhaust screw 10902424 x 4

£ 1.10

Exhaust nut 15896214 x 4

£ 0.55

Exhaust nut 14058519 x 4

£ 1.10

Sub Total 1

£495.26



From Vintage to Classic

Service continued from previous invoice

Gear box.

Drain gear box oil

Remove cross member and remove sump pan.

Clean sump pan, gasket and gearbox. Clean fixing bolts, replace filters.

Apply sealant to sump pan, gasket and to box fixing bolts, refit sump to box.

Remove rear cover, replace filter. Clean sealant from gearbox and cover, refit with new rubber seal.

Rust proof gear box cross member.

Fit N/S/R wheel arch cover, fit nearside air duct for gear box cooler, repairing and lubricate duct jubilee clips.

Repeat for O/S wheel arch and air duct.

Refit boot latch cover and rubber seal over carpet.

Final fill of gearbox oil.

Brakes/Axle

Check rear brake callipers for brake fluid leaks,

Lubricate wheel centres and bolts, refit rear wheels and lower car to ground.

Fill rear axle oil to correct level, fit plug and pipe retainer.

Jack up front of car and remove wheels, visual check of wheel arch areas.

Bleed front brakes.

Lubricate wheel centres and bolts, refit front wheels and lower car to ground.

Torque wheel nuts to correct tightness.

Engine

Drain engine oil from oil tank and sump, clean drain plugs and refit with new copper washers. Refit under shield.

Replace oil filters, and start oil fill.

Remove pipes and wiring to gain access to plug leads.

Remove all plug leads and withdraw plugs.

Set gap on new plugs, lubricate and fit to engine. Replace pipes and wiring previously removed.

Put 'Kseal' into radiator to stop weep at lower corner.

Road tests etc

Check tyre pressures, lubricate valve caps and replace missing O/S rear valve cap.

Road test car.

Check and adjust engine and gearbox oil levels.

Check lights, horn, seat belt buckles, wipers and washers.

Check for lack of oil leaks at filters and drain plugs.

Clear drain tubes at windscreen. Top up windscreen washer reservoir.

Second road test followed by final check of oil levels when cold.

Refit gearbox cover in boot.

Check for correct operation of computer warnings.

Recheck wheel nut torque.

Lubricate door hinges and locks.



Martin's Aston Services

Invoice 160 cont

Ferrari 456M GTA Chassis C000120628

Page 3

Labour 8.25 hours @£30 per hour	£ 247.50
Spark plugs x 12 NGK D9EVX	£ 132.48
Shell Helix Ultra 5W/2	£ 155.45
Mann G3747 fuel filters x 2	£ 42.78
Kseal 1 bottle	£ 9.17
Castrol Dextron 2 gearbox oil 1 litres not used Credit	(£ 8.79)
Gasket 177298 x 1	£ 83.94
Filter 178164 x 1	£ 187.14
Filter 178162 x 1	£ 52.26
Oil filter 206166 x 2	£ 52.15
Copper washers	£ 0.55
Petrol	£ 50.00
Incidentals	£ 7.50
Sub total 2	£ 1012.13

Rust attention continued from previous invoice

Clean rust spots from under floor areas behind front wheels and treat with Tetrasoyl.
Same to areas under bonnet.

Labour 1.25 hours @ £30 per hour Sub total 3 £ 37.50

Window seals and interior

Strip trim panel from N/S door, check window operation.
Check lubrication regulator mechanism and glass runners.
Take regulator mechanism to limit of adjustment.
Reapply water membrane and refit trim panel.
Seal still not correct as regulator is worn – customer decided not to replace regulator.
Repair floor carpet in N/S/R foot well.
Refit rattle foam for lower dash.
Secure wiring harness
Valet interior and exterior of car for return to customer (FOC)

Labour 6 hours @ £30 per hour Sub total 4 £ 180.00

Summary

Exhaust work	sub tot 1	£ 495.26
Service	sub tot 2	£1012.13
Rust protection	sub tot 3	£ 37.50
Window seals and interior	sub tot 4	<u>£ 180.00</u>

Total due £1724.89

Payment due within 7 days

Please make cheque payable to **R. Martin**


Or transfer to Barclays. 20-33-70 A/C No 03463710 quoting invoice number.

*Paid £1724.89
L750 #632
19/3/12*



From Vintage to Classic

Martin's Aston Services

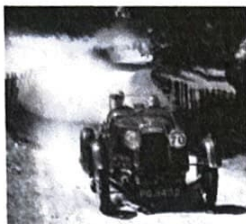

Fruachan House
4 Beech Road
Lenzie
Glasgow G66 4HN

0141 776 4430

service@martinsastonservices.co.uk

10.2.12

Invoice 156

Ferrari 456M GTA Chassis C000120628
PGW 456 Mileage 16734

To work carried out in January.

Smoke & Exhaust work continued

Remove rear boot cover, rear wheel arch vent covers and bumper.

Secure centre exhaust pipe to hold in place, cut rusted bolts on brackets of rear silencers to body mountings.

Cut spring loaded joint bolts on pipes. Then, as pinch bolts holding seal joint brackets on pipe were rusted up, break up right hand silencer pipe seal to remove rear silencer box.

Repeat for Left hand silencer box. (Required to gain access to repair mountings)

Cut pinch bolt heads off seal joint brackets, drill out rusted bolts, retap threads in bracket and fit new pinch bolts using anti seize compound.

Cut open silencer bracket to body fixings, cut out broken bolts and weld in new ones.

Weld bracket closed. Repeat for second silencer.

Strip and clean springs and sleeves and fit new bolts for joint brackets using anti seize compound.

Check all fixings now correct.

After refitting bumper, refit left and right hand rear exhaust silencer boxes with new seal rings. Check and adjust positions of tail pipes to sit in centre of outlet holes in bumper.

Continuing

Labour	19.25 hours @ £30 per hour	£577.50
Exhaust screw	16045024 x 2	£ 1.58
Exhaust washers	112761 x 16	£ 12.48
Exhaust spacers	114749 x 6	£ 6.24
Exhaust nuts	179808 x 4	£ 2.08
Other exhaust fixings	10902424, 15896214, 14058519	£ 2.60
Copper washers x 4		£ 1.00

Sub Total 1

£603.58



From Vintage to Classic

Service continued

Replace fuel filters using 4 new copper washers for seals.

Check air filter – no need to replace it. Clean out lower air box filters and vacuum out air boxes.

Lubricate bonnet and boot hinges also handbrake linkage.

Gearbox oil

Drain gearbox oil from box; remove oil pipes to oil cooler, drain oil from these and from oil cooler.

Disconnect oil cooler electrics, and remove cooler air inlet and cooler from car. Remove fans from oil cooler and check cooler elements for leaks.

Replace the fan foam seals and refit fans to cooler.

Remove gearbox chassis cross member, remove gearbox cover.

Machine cover for correct bolt clearance. Clean incorrect sealant from cover and gearbox face.

Fit new oil filters, fit new seal to cover and refit to gearbox with new washers as required and refit drain plug.

Replace gearbox cross member below box.

Drain differential oil and replace drain plug.

Refit gearbox oil cooler, pipe work, electrical connections and air guides.

Source and collect correct gearbox oil (as 13 litres required, had to go to 4 suppliers!)

Refill differential, allowing oil to settle to ensure correct level achieved.

Refill gearbox with oil – oil level will be rechecked after engine is run – this will circulate oil through cooler requiring oil to be topped up.

Continuing

Brakes

Drain fluid from brake reservoir. Loosen all 4 brake bleed nipples.

Bleed old fluid from all four callipers

Continuing

Labour 16 hours @ £30 per hour	£ 480.00
78 miles (to collect gearbox oil) @ 35 ppm	£ 27.30
Castrol Dextron 2 gearbox oil 13 litres	£ 114.26
Rear Gasket 178158	£ 106.11
Lower Front filter 178159	£ 40.79
Washers x 15	£ 4.50
Parts carriage	<u>£ 36.27</u>
Sub total 2	£ 809.23

Rust attention continued

Remove N/S air box and air horn motor. Mask off cross member and clean off rust. Treat rust area with Tetrasoyl. When dried, remove masking and refit air horn motor and air box.

Clean off rust on O/S underbody and coat with Tetrasoyl.

Repeat for N/S underbody.

Labour 4.5 hours @£30 per hour	£ 135.00
Tetrasoyl	<u>£ 15.40</u>
Sub total 3	£ 150.40



Invoice 156 cont

Martin's Aston Services
Ferrari 456M GTA Chassis C000120628

Page 3

Summary

Sub Total 1	£ 603.58
Sub Total 2	£ 809.23
Sub Total 3	<u>£ 150.40</u>
TOTAL DUE	£1563.21

*Paid £1563.21
CT50 H 626
29/1/12*

Payment due within 7 days
Please make cheque payable to **R. Martin**
Or transfer to Barclays. 20-33-70 A/C No 03463710 quoting invoice number.
IBAN GB77 BARC 2033 7003 4637 10 SWIFTBIC No BARCGB221



From Vintage to Classic

Martin's Aston Services



Fruachan House
4 Beech Road
Lenzie
Glasgow G66 4HN

0141 776 4430

service@martinsastonservices.co.uk

3.11.11

Invoice 149

Ferrari 456M GTA Chassis C000120628
PGW 456 Mileage 16734

To

Collect car from Perth and take to workshops
2.75 x 2 people = 5.5 hours @ £20 per hour
Miles of 2nd car 120 @ 35 ppm

£110.00
£ 42.00
£152.00

Exhaust smoke

Check vacuum servo pipe for brake fluid – was dry internally.

Removed plenum pipes from both sides, cleaned out traces of oil contamination.

Remove front under tray/air dam

Removed bolts from sampling holes in pipes before catalyts – observed gasses escaping – inconclusive as gasses too hot to see smoke.

From underside of car, removed rear radiator air inlets, strengthening bar, and disconnected all exhaust sections.

Ran engine with no exhaust connected behind the catalyts – still smoking though not as strongly.

Indicates potentially no contamination in exhaust system.

Removed catalyts and ran engine – gasses seemed to be clear till they cooled then turned to smoke.

Indicates not caused by contamination in catalyts.

Refitted O/S exhaust and a straight pipe from N/S catalyts to rear of car, ran engine, smoke appeared from both sides.

The straight pipe was sloping downwards with its end resting on the wet ground, it was noted that an oily film appeared on the water on the ground from the end of the pipe.

This appears to have come from the smoke condensing.



From Vintage to Classic

After engine cooled overnight, used a 'borescope' to look up the exhaust manifold hoping to see the exhaust valves to see if there was any oil on them.

Due to the complex curves of the manifolds, the 'borescope' could not be pushed in far enough to see the valves but oil like substance noted in exhaust port..

Temporarily refitted exhaust system.

Ongoing

18 hours @ £30 per hour	£540.00
Use of straight pipe	<u>£ 5.00</u>
	£545.00

Note; Some parts have been ordered to replace rusted through/broken fittings on the exhaust system, these will be charged on next invoice when they have arrived.

Service items

Remove battery clamps, draw battery forward and check acid levels, top up 2 cells.
Return and refit clamps.

Ongoing

0.5 hours @ £30 per hour	£ 15.00
--------------------------	---------

Note; Other service items have been delayed until it is determined whether the engine needs to be dismantled or not.

Header tank

Remove header tanks, reglue header tank to wheel arch joint, refit tank.

0.5 hour @ £30 per hour	£ 15.00
-------------------------	---------

Rust removal

Remove O/S Headlamp, drill out 2 broken bolts, re-tap fixing holes, clean off surface corrosion.

Remove oil tank and air box, scrape rust from chassis, mask off and repaint with Tetrasoyl, remove masking, refit air box and oil tank.

Clean headlamp surfaces and coat metal parts with sealant, refit headlamp and adjust alignment. Check fit when bonnet closed and for correct operation.

5.75 hours @ £30 per hour	£172.50
2 headlamp bolts and washers	£ 0.87
Tetrasoyl	<u>£ 1.50</u>
	£174.87

Total due	<u><u>£901.87</u></u>
-----------	-----------------------

Payment due within 7 days

Please make cheque payable to R. Martin

Or transfer to Barclays. 20-33-70 A/C No 03463710 quoting invoice number



From Vintage to Classic

*Paid £901.87
CTSB # 617
18/12/11*



Retail Sales Invoice

Please retain this invoice as proof of purchase as necessary in the event of warranty work being required.

Customer

Centre 409 30 Sep 2011 5:52 PM

PERTH-MAIN STREET
MAIN STREET BRIDGEN
PERTH
PERTHSHIRE
PH2 7HD

Tel 01738-638595

Contact THOMAS MORGAN

Registration PGW456

Make/Model Ferrari 456M 5.5

Mileage 16,718

Quality Control

Fitted By STEVEN NARDONE

Checked By THOMAS MORGAN

Part No.	Description	Unit Price	Qty	Price Inc. VAT
SPEHOS-137313	FRONT BRAKE FLEXI	£184.00	1	£184.00
BFBLEED	BRAKE BLEED	£11.95	1	£11.95
Total Price Inc. VAT				£195.95

Supplied And Fitted

VAT Registration No. 380 0948 50

VAT Analysis	Amount	VAT Element
20.0%	£195.95	£32.66

Payment Amount

£195.95 Mastercard 5434 **** * 1638

Registered Office: Kwik Fit (GB) Limited, Bridgewater Place, Water Lane, Leeds LS11 5DY Reg. No. 1009184

TO OUR CUSTOMERS PLEASE SEE REVERSE FOR IMPORTANT INFORMATION



Card Voucher

30 Sep 2011 5:52 PM

Please retain this invoice as proof of purchase is necessary in the event of warranty work being required.

Centre
409 PERTH-MAIN STREET
MAIN STREET BRIDGEN
PERTH
PERTHSHIRE
PH2 7HD
Tel 01738-638595

Contact
THOMAS MORGAN

SALE



Merchant No	BMS		
Card Number	**** * 1638	Issue	3
Expiry Date	05/13		
Source	ICC		
Authorisation Terminal	090501 20629409 / 14090001	AID Trans No	A0000000041010 012769
Card Amount	MASTERCARD £195.95		

Please debit my account with the above total

PIN Verified

Customer Copy

Please retain for your records

TO OUR CUSTOMERS PLEASE SEE REVERSE FOR IMPORTANT INFORMATION



Graypaul Edinburgh

CASH SALE INVOICE

You were served by: Douglas Fairgrieve Inv. Printed By.

Account No.	Document Number	Date & Tax Point	Order Number	Route	
C00002	24003097	27/07/2010	206166		
Make & Model	Chassis No.	Engine No.	Mileage	Time Page	
Ferrari 456M GT Auto	ZFFWP50C000120628	58125	15209	11:17 1	
Reference No.	Reg No.	Reg Date	VS No.	W.I.P. No.	Job No.
	PGW456	01/01/2000		W 18767	2777

Description of Goods / Services	Qty.	Unit Price	Unit	Net Total	V
A LAB Carried out Annual Service to Ferrari specification including changing oil and pollen filter. Renewed alarm remote batteries.	472.00	20 %	94.40	377.60	S
A LAB Vehicle has been overfilled with oil - check for any damage/issues caused. AA removed excess oil. Removed plenum chambers cleaned out excess oil; and refitted chambers with new gaskets	236.00	20 %	47.20	188.80	S
A LAB Removed and replaced corroded metal fuel pipes to fuel filters	288.00	20 %	57.60	230.40	S
A LAB Removed corroded suspension pipe, fitted new pipe filled and bled system.	240.00	20 %	48.00	192.00	S
A LAB Removed both rear wheels and replaced tyre valves then refitted wheels	59.00	2 %	1.18	57.82	S
A HEALTH Carried out Club Monza health check				F.O.C.	S
L SHELL Shell Helix High Performance Engine Oil	197.88	20 %	39.57	158.31	S
X ZWINSW500 SCREENWASH	1.00	2.20	EACH A	1.98	S
X ZSHEHU1L SHELL HELIX ULTRA 5W	1.00	15.49	EACH A	13.95	S
X FMC4184/50 SHELL BRAKE FLUID	1.00	10.70	EACH 45	9.63	S

All goods remain the property of the vendor until full payment has been made and any relevant cheques cleared.
Cheques will be accepted to the limit of a supporting Bankers Card. Full terms of business available on request and on reverse of document.

V	Rate	Service/Goods	VAT

E & O.E.

Graypaul Edinburgh (Ferrari/Maserati)
8 Whitehill Road
Fort Kinnaird
Edinburgh
EH15 3HR
Tel 0131 4754500
Fax 0131 4754545

Registered Office:
Graypaul Motors Limited
Sytner Group, 2 Penman Way,
Grove Park, Leicester LE19 1ST
Registered in England No. 3079284
VAT Registration No. 610 6250 86
Web: www.sytner.co.uk Email: ferrari.edinburgh@sytner.co.uk

A "Sunday Times
Best Company
to Work For"
award winner





Graypaul Edinburgh

CASH SALE INVOICE

You were served by: Douglas Fairgrieve Inv. Printed By: Douglas Fairgrieve

Account No.	Document Number	Date & Tax Point	Order Number	Route		
C00002	24003097	27/07/2010	206166			
Make & Model	Chassis No.	Engine No.	Mileage	Time	Page	
Ferrari 456M GT Auto	ZFFWP50C000120628	58125	15209	11:17	2	
Reference No.	Reg No.	Reg Date	VSB No.	W.I.P. No.	Job No.	
	PGW456	01/01/2000		W 18767	2777	

Description of Goods / Services	Qty.	Unit Price	Unit	Net Total	V
X Z007071004B LUBRICANT	1.00	4.26	EACH A	3.84	S
X Z007071004A CLEANSER	3.00	3.49	EACH A	9.43	S
X F10263460 GASKET PKT=20	1.00	0.60	EACH 45	0.54	S
X F10280060 COPPER WASHER	1.00	0.60	EACH 45	0.54	S
X F10280060 COPPER WASHER	1.00	0.60	EACH 45	0.54	S
X F10257060 COPPER WASHER PKT	1.00	0.60	EACH 45	0.54	S
X F151562 AIR FILTER (456GT/F3	2.00	27.61	EACH 45	49.70	S
X F64241800 POLLEN FILTER ASSY R	1.00	92.63	EACH 45	83.37	S
X F174166 TYRE VALVE (INC SPACE	1.00	4.03	EACH 69	3.63	S
X F174166 TYRE VALVE (INC SPACE	1.00	4.03	EACH 69	3.63	S
X F206166 OIL FILTER	2.00	15.84	EACH 45	28.52	S
X F154562 007388/GASKET	2.00	7.78	EACH 3	14.79	S
X Z23A REMOTE BATTERY	2.00	3.65	EACH A	6.57	S
X F169626 007388/L.H.REAR RIGI	1.00	50.19	EACH 3	47.69	S
X F180913 007388/UNION	1.00	15.49	EACH 3	14.72	S
X F154161 007388/PIPE	1.00	21.60	EACH 3	20.52	S
T REP				F.O.C.	S

Tech Report; all brake discs have surface corrosion, all wheel bolts corroded, handbrake adjusted mechanism corroded, recommend fuel filters, cam-belts, aux-belts, spark-plugs and air conditioning service and receiver drier.

All goods remain the property of the vendor until full payment has been made and any relevant cheques cleared. Cheques will be accepted to the limit of a supporting Bankers Card. Full terms of business available on request and on reverse of document.

V	Rate	Service/Goods	VAT	Net	1519.06
S	17.50	1519.06	265.84	V.A.T.	265.84
				Total	1784.90
				Paid	0.00
				Owing	1784.90

E. & O. E.

Graypaul Edinburgh (Ferrari/Maserati)
8 Whitehill Road
Fort Kinnaird
Edinburgh
EH15 3HR
Tel 0131 4754500
Fax 0131 4754545

Registered Office:
Graypaul Motors Limited
Sytner Group, 2 Penman Way,
Grove Park, Leicester LE19 1ST
Registered in England No. 3079284
VAT Registration No. 610 6250 86
Web: www.sytner.co.uk Email: ferrari.edinburgh@sytner.co.uk

A "Sunday Times
Best Company
to Work For"
award winner





Retail Sales Invoice

Customer

Centre 409 9 Oct 2009 1:38 PM

PERTH-MAIN STREET
MAIN STREET BRIDGEN
PERTH
PERTSHIRE
PH2 7HD

Tel 01738-638595

Contact NORMAN ROBERTSON

Make/Model Ferrari 456M 5.5

Mileage 14,871

Quality Control

Fitted By BARRY MCLEAN

Checked By CRAWFORD BURNS

Part No.	Description	Unit Price	Qty	Price Inc. VAT
BLAD24	WIPER BLADE	£9.99	1	£9.99
MOTFOC - Passed: 350492389256		£0.00		£0.00
	VOSA-FREE TEST ITEM			
SPEHOS-FLEXI HOSE FRONT		£94.62	1	£94.62
Total Price Inc. VAT				£104.61

Supplied And Fitted

VAT Registration No. 380 0948 50

VAT Analysis	Amount	VAT Element
0.00%	£0.00	£0.00
15.0%	£104.61	£13.64

Payment Amount

£104.61 Maestro 6759 **** * 0670

TO OUR CUSTOMERS PLEASE SEE REVERSE FOR IMPORTANT INFORMATION

Please retain this invoice as proof of purchase as necessary in the event of warranty work being required.

Registered Office: Kwik-Fit (GB) Limited, 3 Hardman Square, Spinningfields, Manchester M3 3EB Reg. No. 1009184



Retail Sales Invoice

Customer

Centre 409 16 May 2009 3:23 PM

PERTH-MAIN STREET
MAIN STREET BRIDGEN
PERTH
PERTHSHIRE
PH2 7HD

Tel 01738-638595

Contact BARRY MCLEAN

Make/Model Ferrari 456 5.5

Mileage 14,358

Quality Control

Fitted By BARRY MCLEAN

Checked By STEVEN OGILVY

Part No.	Description	Unit Price	Qty	Price Inc. VAT
BAL	WHEEL BALANCE	£5.25	2	£10.50
DISP	ECO TYRE DISPOSAL	£1.50	2	£3.00
NITRO	NITROGEN INFLATION	£1.00	2	£2.00
VAL	VALVE	£3.25	2	£6.50
BR285/40Z17S01		£244.00	2	£488.00
Total Price Inc. VAT				£510.00

Supplied And Fitted

VAT Registration No. 380 0948 50

VAT Analysis	Amount	VAT Element
15.0%	£510.00	£66.52

Payment Amount

£510.00 Mastercard 5434 **** * 1638

TO OUR CUSTOMERS PLEASE SEE REVERSE FOR IMPORTANT INFORMATION

Please retain this invoice as proof of purchase as proof of purchase is necessary in the event of warranty work being required.

Registered Office: Kwik-Fit (GB) Limited, 3 Hardman Square, Spinningfields, Manchester M3 3EB Reg. No. 1009184



Card Voucher

Centre 409 PERTH-MAIN STREET
 MAIN STREET BRIDGEN
 PERTH
 PERTHSHIRE
 PH2 7HD
 Tel 01738-638595

16 May 2009 3:23 PM

Contact BARRY MCLEAN

You'll be
SALE
 amazed at
 what we
 do.

Merchant No BMS
Card Number **** * 1638 **Issue** 1
Expiry Date 05/10
Source ICC
Authorisation 098560 **AID** A000000041010
Terminal 20629409 / 14090001 **Trans No** 006449
Card Amount MASTERCARD £510.00

Please debit my account with the above total

PIN Verified

Customer Copy

Please retain for your records

TO OUR CUSTOMERS PLEASE SEE REVERSE FOR IMPORTANT INFORMATION

Please retain this invoice as proof of purchase as necessary in the event of warranty work being required.

Registered Office: Kwik-Fit (GB) Limited, 3 Hardman Square, Spinningfields, Manchester M3 3EB Reg. No. 1009184



Graypaul Edinburgh

CASH SALE INVOICE

You were served by: Mark Cooper

Inv. Printed By: Mark Cooper

Account No.	Document Number	Date & Tax Point	Order Number	Route	
C00016	24001492	16/10/2008			
Make & Model	Chassis No.	Engine No.	Mileage	Time	Page
Ferrari 456M GT Auto	ZFFWP50C000120628	58125	18538	16:45	1
Reference No.	Reg No.	Reg Date	VS# No.	W.I.P. No.	Job No.
	PGW456	01/01/2000		W 16239	1305

Description of Goods / Services	Qty.	Unit Price	Unit	Net Total	V
R MOTS				40.00	O
MOT				13.10	s
J MOTH				F.O.C.	S
MOT Handling Charge					
F LAB				F.O.C.	S
Check for fuel flap release button sticking in					
Adjusted fuel release button surround and					
tested operation - ok.					
F LAB				F.O.C.	S
Check mirror adjustment button has fallen					
behind panel					
Secured wing mirror adjustment switch					
F LAB				1045.00	S
Check for exhaust rattle					
Noise heard is worn torque tube bearings					
Removed torque tube and sent for specialist					
repair. Refitted torque tube.					
F LAB				380.00	S
Check for brake vibration from speed					
Replaced front brake pads and front brake discs					
Replaced rear brake pads and rear brake discs					
Stripped all brake calipers and cleaned, bled					
brake system and adjusted handbrake.					
S SUB				150.00	S
Replaced bearings in torque tube					
F LAB				285.00	S

All goods remain the property of the vendor until full payment has been made and any relevant cheques cleared.
 Cheques will be accepted to the limit of a supporting Bankers Card. Full terms of business available on request and on reverse of document.

V	Rate	Service/Goods	VAT



E. & O. E.

Graypaul Edinburgh (Ferrari/Maserati)
 8 Whitehill Road
 Fort Kinnaird
 Edinburgh
 EH15 3HR
 Tel 0131 4754500
 Fax 0131 4754545

Registered Office:
 Graypaul Motors Limited
 Sytner Group, 2 Penman Way,
 Grove Park, Leicester LE19 1ST
 Registered in England No. 3079284
 VAT Registration No. 610 6250 86
 Web: www.sytner.co.uk Email: ferrari.edinburgh@sytner.co.uk

A "Sunday Times
 Best Company
 to Work For"
 award winner





Graypaul Edinburgh

CASH SALE INVOICE

You were served by: Mark Cooper

Inv. Printed By: Mark Cooper

Account No.	Document Number	Date & Tax Point	Order Number	Route	
C00016	24001492	16/10/2008			
Make & Model	Chassis No.	Engine No.	Mileage	Time Page	
Ferrari 456M GT Auto	ZFFWP50C000120628	58125	18538	16:45 2	
Reference No.	Reg No.	Reg Date	VSb No.	W.I.P. No.	Job No.
	PGW456	01/01/2000		W 16239	1305

Description of Goods / Services	Qty.	Unit Price	Unit	Net Total	V
Removed rear shock absorbers, removed springs and lower bushes and fitted to new shock absorbers. Fitted new o/s and n/s rear shock absorbers. Topped up suspension fluid and tested acutators.					
Y VALET				F.O.C.	S
Carried out Full SwissVax Valet.					
X F70000925 PADS SET FOR REAR CA	1.00	273.47	EACH 5.0	259.80	S
X F165686 BRAKE DISK	2.00	119.66	EACH 5.0	227.36	S
X F144061 BRAKE DISC	2.00	115.65	EACH 5.0	219.74	S
X F168319 BEARING	3.00	128.62	EACH 5.0	366.57	S
X F183636 REAR SHOCK ABSORBER.	2.00	437.91	EACH 5.0	832.03	S
X ZCARR Carriage	1.00	0.00	EACH 0.0	F.O.C.	S
X Z007071004A CLEANSER	2.00	3.49	EACH 0.0	6.98	S
X F10280060 COPPER WASHER	1.00	0.14	EACH 0.0	0.14	S
X F10280060 COPPER WASHER	3.00	0.14	EACH 0.0	0.42	S
X F11270260 GASKET	4.00	0.60	EACH 0.0	2.40	S
X F70000924 005404/PADS SET FOR	1.00	295.52	EACH 5.0	280.75	S
X FMC4184/50 SHELL BRAKE FLUID	1.00	10.70	EACH 0.0	10.70	S
X Z007071004A CLEANSER	1.00	3.49	EACH 0.0	3.49	S
X Z007071004A CLEANSER	1.00	3.49	EACH 0.0	3.49	S
X FMC4184/50 SHELL BRAKE FLUID	1.00	10.70	EACH 0.0	10.70	S
X ZMCK001 SWISSVAX	1.00	80.00	EACH 0.0	80.00	S

All goods remain the property of the vendor until full payment has been made and any relevant cheques cleared. Cheques will be accepted to the limit of a supporting Bankers Card. Full terms of business available on request and on reverse of document.

V	Rate	Service/Goods	VAT	Net	
O	0.00	40.00	0.00		4215.72
S	17.50	4164.57	728.80	V.A.T.	730.75
S	17.50	11.15	1.95	Total	4946.47
				Paid	0.00
				Owing	4946.47

© ASP

E. & O. E.

Graypaul Edinburgh (Ferrari/Maserati)
8 Whitehill Road
Fort Kinnaird
Edinburgh
EH15 3HR
Tel 0131 4754500
Fax 0131 4754545

Registered Office:
Graypaul Motors Limited
Sytner Group, 2 Penman Way,
Grove Park, Leicester LE19 1ST
Registered in England No. 3079284
VAT Registration No. 610 6250 86
Web: www.sytner.co.uk Email: ferrari.edinburgh@sytner.co.uk

A "Sunday Times
Best Company
to Work For"
award winner



Continental Imports

CONTINENTAL IMPORTS
1219 S. MAIN STREET
GAINESVILLE, FL 32601-2023
Lic.# MV-11119

FOR

MAKE
MILES

(352) 377-6604 09/25/08 INVOICE 120713

--SHOP LABOR DESCRIPTION-----	MECH	AMOUNT--
SALESMAN 25	24C	N/C
*****	24C	N/C
* THANK YOU FOR YOUR *		
* PATRONAGE *		

Handling service charge	24C	12.00
--OTHER CHARGES DESCRIPTION-----	CODE--	AMOUNT--
US Postal Service Express	O	30.50

If you would like to
receive Service Reminders
via E-mail,
please let us know.

E-mail us at
inv@continentalimports.com



**Bosch
Authorized
Service**

QTY	PART NUMBER	PARTS NAME OF PART	PRICE
1	X33703551	(RAD) CART 06 DISC MAGAZ 2660	49.58

Labor warranted for 12 months/12,000 miles. Any warranties on parts and accessories sold hereby are made by the manufacturer. The above shop disclaims all warranties, including implied warranties of merchantability or fitness for the particular purpose and does not authorize any person to assume for it any liability.

***** PLEASE NOTE *****
NO RETURNS ON SPECIAL ORDER PARTS.
NO RETURNS ON ELECTRICAL OR USED PARTS.
NO REFUNDS WITHOUT THIS INVOICE.
20% RESTOCKING CHARGE ON ALL RETURNS

Visit our Web site at
www.continentalimports.com

BLAUPUNKT

LABOR TOTAL	12.00
OTHER CHARGES	30.50
PARTS TOTAL	49.58
SALES TAX	.00
PD IN ADVANCE	.00
PAID BANKCARD	92.08